

Design and Experimental Investigation of Trikarenos: A Fault-Tolerant 28nm RISC-V-based SoC

Michael Rogenmoser, Philip Wiese, Bruno Endres Forlin, Frank K. Gürkaynak,
Paolo Rech, Alessandra Menicucci, Marco Ottavi, Luca Benini

35-words abstract: We present a fault-tolerant by-design RISC-V SoC and experimentally assess it under atmospheric neutrons and 200 MeV protons. The dedicated ECC and Triple-Core Lockstep countermeasures correct most errors, guaranteeing a device cross-section lower than $5.36 \times 10^{-12} \text{ cm}^2$.

arXiv:2407.05938v1 [physics.ins-det] 8 Jul 2024

Corresponding and Presenting Author: Michael Rogenmoser; Email: michaero@iis.ee.ethz.ch; Telephone: +41 44 632 54 33; Address: ETZ J78, Gloriastrasse 35, 8092 Zürich, Switzerland;

Contributing Authors:

Michael Rogenmoser, Philip Wiese, and Frank K. Gürkaynak are with the Integrated Systems Laboratory at ETH Zurich, Switzerland

Bruno Endres Forlin is with the Computer Architecture for Embedded Systems of the University of Twente, the Netherlands

Paolo Rech is with the Department of Industrial Engineering of the University of Trento, Italy

Alessandra Menicucci is with the Department of Space Engineering at the Delft University of Technology, the Netherlands

Marco Ottavi is with the Computer Architecture for Embedded Systems of the University of Twente, the Netherlands and the Department of Electronic Engineering at the University of Rome, Tor Vergata, Italy

Luca Benini is with the Integrated Systems Laboratory at ETH Zurich, Switzerland and the Department of Electrical, Electronic, and Information Engineering at the University of Bologna, Italy

Session Preference: F - Radiation Hardening Techniques

Presentation Preference: Oral

I. INTRODUCTION

In the automotive and space domains, the reliability of semiconductor chips and systems-on-chip (SoCs) is critical. The space sector faces challenges due to high radiation levels causing single event effects (SEEs), which can disrupt the normal functioning of electronic components. For the automotive industry, on the other hand, reliability is a major intrinsic concern since atmospheric neutrons can cause single event upsets (SEUs), leading to crashes or unexpected behaviors. Various strategies are employed to mitigate these risks. At the technology level, radiation hardened by design technologies or specialized cells can enhance resilience. Alternatively, architectural solutions such as dual modular redundancy, triple modular redundancy, or error correction codes (ECC) can be implemented to mask faults and ensure a safe operation in critical applications.

The RISC-V architecture is rapidly gaining traction in safety-critical applications, thanks to the openness of the instruction set architecture (ISA) and the availability of open processor IPs [1]. As a key advantage, the RISC-V flexibility allows customization and improvement of the ISA and the underlying hardware, tuning them to meet specific (reliability) requirements. Consequently, the RISC-V ecosystem is being increasingly adopted in applications where system reliability is non-negotiable [2].

Within this context, our paper focuses on the experimental evaluation of *Trikarenos* [3], a SoC designed to address the reliability requirements of both automotive and space applications. *Trikarenos* leverages the flexibility of the RISC-V architecture, integrating a triple-core lockstep (TCLS) system alongside ECC and scrubbing in memory. This work investigates the hardening by-design features of *Trikarenos* under neutron and proton radiation, evaluating its resilience for automotive and space contexts. Specifically, our contributions include:

- The measurement of static random-access memory (SRAM) vulnerability within *Trikarenos*, focusing on the effectiveness of ECC protection and scrubbing techniques.
- An evaluation of the TCLS mechanism, demonstrating its capacity to maintain the functionality of the processor in the event of a fault.
- A performance assessment of *Trikarenos* in various radiation environments, including an atmospheric setting dominated by neutrons and an orbital environment characterized by protons.

II. SoC ARCHITECTURE DESCRIPTION

The *Trikarenos* architecture, presented in [3], implements an adaptation of the PULPissimo, a RISC-V-based microcontroller design. As shown in Figure 1, *Trikarenos* includes 3 physically separated Ibex cores connected to a low latency interconnect exposing 256 KiB of SRAM memory. Furthermore, the SoC features a boot memory, timers, and peripherals such as general purpose input/outputs (GPIOs), UART and QSPI with direct memory access, and a JTAG debug unit for programming.

To enable tolerance to SEUs at an architectural level, we augment *Trikarenos*' processing cores with on-demand

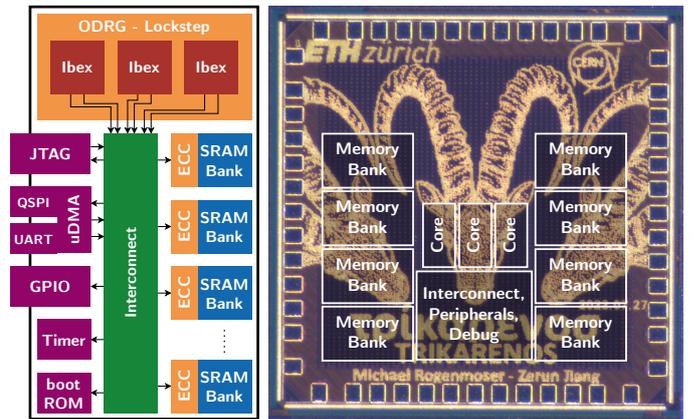


Fig. 1: *Trikarenos* SoC architectural block diagram (left) and annotated die shot (right).

redundancy grouping [4], a configurable TCLS mechanism. While the system allows the cores to operate independently for increased performance, this investigation focuses on the locked reliability mode, allowing for the detection and correction of any mismatch in the cores' operation. The SRAM memory, occupying the majority of the design area, is protected with a single error correction, double error detection Hsiao code, storing 39 bits for each 32-bit word, effectively containing 2 555 904 bits for the 256 kB memory. To ensure minimal performance impact and avoid error accumulation, the mechanism supports an efficient read-modify-write architecture for sub-word writes and features a configurable scrubber, continuously scanning the memory banks and correcting any detected single bitflip.

To track the SoC's status, the architecture features a variety of telemetry registers counting errors in the system. This allows efficient readout of errors in the memory banks detected on access and detected by the scrubber, both for correctable and uncorrectable faults.

Trikarenos is implemented in TSMC 28HPC+, a 28nm bulk process that has been shown to be tolerant to total ionizing dose (TID) effects [5], targeting operating frequencies up to 250 MHz (at 0.9 V), occupying 0.7 mm² logic area in the 2 mm² design shown in Section II. In the experimental setup, *Trikarenos* operates at 125 MHz and 0.9 V.

III. EVALUATION METHODOLOGY

A. Testing Facilities

We conducted experiments at the ChipIR and HollandPTC facilities to assess the sensitivity of *Trikarenos* to neutron and proton radiation. The ChipIR beamline, located at the Rutherford Appleton Laboratories in the United Kingdom, is designed to replicate the energy spectrum of atmospheric neutrons [6]. On the other hand, HollandPTC, located in Delft, The Netherlands, is equipped with a fixed horizontal proton beamline, delivering a beam with nominal energies ranging from 70 MeV up to 240 MeV, and its Cyclotron can deliver

nominal beam currents from 1 nA up to 800 nA and a maximum flux of $1.13 \times 10^9 \text{ p cm}^{-2} \text{ s}^{-1}$ [7].

B. Error model

Our experiments are focused on analyzing SEEs in the RISC-V-based Trikarenos SoC. For the TSMC 28nm technology, other research has already investigated the TID effects [5], showing extreme tolerance levels.

We investigate the error mechanisms listed in Table I, which are traceable with the SoC telemetry registers and given test applications.

TABLE I: Observable error types and classification

Observed Error	Class
Single SRAM errors (scrubber)	Correctable
Multiple SRAM errors (on access & scrubber)	Functional Error
TCLS errors	Correctable
Miscalculations (silent data corruption (SDC))	Functional Error
System crashes	Functional Error
Single event latchup (SEL)	Total Loss

While most error sources can be traced back to SEUs or multiple/accumulation thereof, system crashes can have different causes. They can be traced back to a single event functional interrupt or a SEU affecting an unprotected, critical component, such as the system’s interconnect. While some GPIO signals and routines are designed to assist in differentiating these faults, exact cause identification remains difficult.

Finally, most data corruption will be detected by one of the two mitigation mechanisms. ECC protection in the SRAM memory will catch an error affecting stored data, and the TCLS mechanism will detect data corruption in the cores. For a particle strike in the cores, it is more than likely that only a single core will be affected due to their separation, thus resulting in different outputs from the cores and an error in the voter while storing the result back in memory.

C. Experimental Setup

The test setup, shown in Figure 2, comprised a dedicated testing printed circuit board containing the device under test (DUT) and a test harness, a monitoring device with an interface board. A Raspberry Pi (RPI) single-board computer served as the primary control and monitoring system for the entire test suite. The interface board supplied the necessary 1.8 V I/O and 0.9 V core voltages for the Trikarenos SoC, in addition to incorporating a level shifter, dual clock generation circuits, and several status LEDs for real-time feedback and diagnostics. This setup controlled the power supply to the DUT, managed binary loading into the SRAM via JTAG, and monitored GPIOs pins while also interfacing with the DUT via JTAG and UART for data acquisition.

The test application running on the DUT was carefully designed to emulate a realistic application and maximize the propagation probability and observability of bitflips inside the core complex and memory. To emulate a realistic application, Trikarenos executed the Coremark benchmark, implementing a variety of workloads to test a processor core. The final

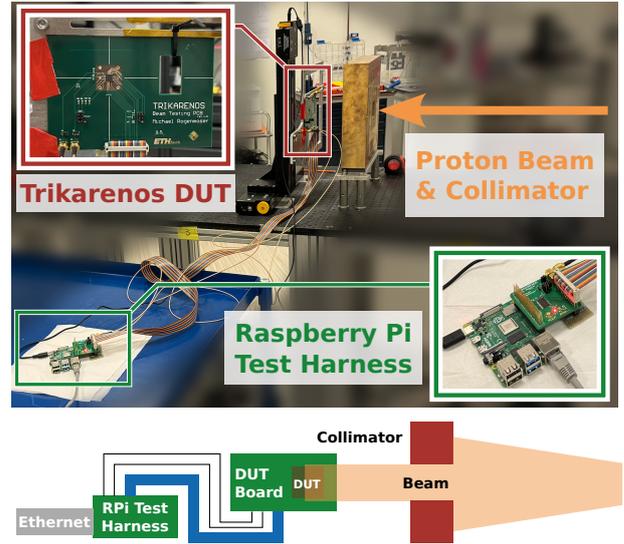


Fig. 2: Annotated image of testing setup at HollandPTC (top) and schematic of the testing setup (bottom), showing the proton beam, the device under test (DUT), and the test harness.

version used for the proton tests augmented this with a section continuously executing simple *not* operations on the processor core’s registers filled with a checkerboard pattern and periodically saving these values to memory. Saving the register values makes use of the TCLS voters to detect any errors. This maximized the exposure time of the vulnerable components, allowing a possible mismatch between the cores in TCLS to trigger an error.

For testing, the DUT application facilitated real-time error monitoring by periodically transmitting the status of memory-mapped registers counting errors through the UART and JTAG interfaces. The test harness acquired this transmitted data, additionally monitoring other GPIO signals designed to indicate other system failures. Finally, in the event of critical, non-recoverable errors, the monitoring system would halt the cores and dump all relevant registers and memory areas for subsequent analysis. This comprehensive approach, combined with multiple redundant recovery mechanisms and extensive logging strategies, equipped the setup for effective long-term and unsupervised radiation testing.

Data integrity and logging were critical concerns addressed in our setup. All test data was logged locally on NAND flash memory using an SD card. To ensure a proper backup in case of SD card corruption, the data, along with RPi’s system logs to assist in tracing errors, were transmitted to a computer outside the beam room over ethernet for later processing. To ensure the detection of latch-up events, a current monitor and a current-limited power switch were added to the test harness to prevent permanent damage to the DUT.

IV. EXPERIMENTAL RESULTS

Throughout all our tests, we did not observe any uncorrectable SRAM errors, miscalculations, nor SELs indicated by a change in power consumption. Therefore, the results below

TABLE II: Cross-section results of Trikarenos under neutron beam for a fluence of 6.88×10^{11} neutrons/cm²

Component	Error Count	Errors / bit	Cross-Section [†]
Single SRAM errors	18786	7.35×10^{-3}	2.77×10^{-8} cm ²
TCLS errors	13	-	3.23×10^{-11} cm ²
System crashes	0	-	5.36×10^{-12} cm ²

[†] Upper-bound with a 95% confidence interval & Poisson distribution. This assumes one additional fault, i.e., device failure after the tests.

only differentiate correctable SRAM errors, correctable TCLS errors, and uncorrectable errors resulting in a system crash. Because some errors are rare or possibly even zero, we calculate upper and lower estimates of the cross-section assuming a Poisson distribution and use the relationship between the cumulative distribution function of the Poisson and chi-squared distribution [8]. To calculate these estimates σ we use

$$\frac{1}{2F}\chi^2\left(\frac{\alpha}{2}, 2N\right) < \sigma < \frac{1}{2F}\chi^2\left(1 - \frac{\alpha}{2}, 2(N+1)\right) \quad (1)$$

where $\chi^2(p, n)$ is the quantile function of the chi-squared distribution with n degrees of freedom, α describes the $100(1 - \alpha)$ percent confidence interval, F is the total exposed fluence, and N is the number of detected errors. All calculations below use a 95% confidence interval.

To differentiate between errors attributed to the test setup and those inherent to the DUT, we conducted a detailed analysis of the system logs from the RPi. Our evaluation identified that most errors originating from the setup involved SD card-related timeouts and kernel segmentation faults.

A. Neutron Tests

At the ChipIR facility [6], Trikarenos was exposed to a total fluence of 6.88×10^{11} n cm⁻². While active, the beam produced an average neutron flux of 4.90×10^6 n cm⁻² s⁻¹ with an energy spectrum representing that found for atmospheric neutrons at ground level up to 800 MeV. The measurements are shown in Figure 3, and the errors and estimated cross-sections are summarized in Table II.

1) *Memory Errors*: During the neutron exposure, we observed a total of 18786 errors for a median error rate of 492 error h⁻¹. All of these errors were single errors, detected and corrected by the scrubber checking the hardware ECC encoding. Using Equation (1) allows us to estimate the cross-section of the memory to $(2.75 \pm 0.02) \times 10^{-8}$ cm². With 2555904 bits, we measured an average bit error rate of 1.92×10^{-4} error bit⁻¹ h⁻¹ for a cross-section per bit of $(1.08 \pm 0.01) \times 10^{-14}$ cm² bit⁻¹. This rate is around 11% lower compared to the findings in [9], which evaluated the 14 MeV neutron sensitivity of an SRAM manufactured in the same technology.

2) *Core Errors*: During the experiment, we measured 13 correctable TCLS errors. We estimate the cross-section of recoverable TCLS events to be $(2.55 \pm 0.68) \times 10^{-11}$ cm². No unrecoverable faults were measured. Thus, we can only estimate the upper-bound cross-section of the unrecoverable events to 5.36×10^{-12} cm².

TABLE III: Cross-section results of Trikarenos under proton beam for a fluence of 2.91×10^{12} protons/cm²

Component	Error count	Errors / bit	Cross-Section [†]
Single SRAM error	8249	3.23×10^{-3}	2.89×10^{-9} cm ²
TCLS errors	11	-	6.76×10^{-12} cm ²
System crashes	1	-	1.91×10^{-12} cm ²

[†] Upper-bound with a 95% confidence interval & Poisson distribution. This assumes one additional fault, i.e., device failure after the tests.

To contextualize, we consider a terrestrial environment to provide estimations for mean time to failure (MTTF). Assuming an integral flux density of 20 n cm⁻² h⁻¹ above 1 MeV corresponding to the ground radiation level in New York [10], the minimum MTTF for a terrestrial application with an active TCLS recovery mechanism is above 1.06 million years.

B. Proton Tests

Trikarenos was exposed to a total fluence of 2.91×10^{12} p cm⁻² over 55 min of active beam time, a notably high value. This value is a direct result of our stress testing of the system with the highest flux available in the facility. We tested a range of beam currents for 200 MeV proton with the flux rate extracted from calibration data provided by the facility operator. Figure 3 displays the measurements, and Table III presents the observed errors alongside estimated cross-sections.

1) *Memory Errors*: In total, we measured 8249 errors for a median error rate of 9180 error h⁻¹, all of which were corrected by the scrubbers, leading to SRAM cross-section $(2.86 \pm 0.03) \times 10^{-9}$ cm². This results in a cross-section per bit of $(1.12 \pm 0.01) \times 10^{-15}$ cm² bit⁻¹.

2) *Core Errors*: During the experiment, we measured 11 recoverable and 1 unrecoverable errors. Our data indicates that an unresponsive debug module caused the unrecoverable error, an element of the SoC currently not protected. We estimate the cross-section of recoverable TCLS events to $(5.25 \pm 1.51) \times 10^{-12}$ cm² and the upper bound for unrecoverable faults to 1.91×10^{-12} cm². Using this, we can calculate the minimum mean fluence to failure of the system with the TCLS recovery mechanism to 5.23×10^{11} p cm⁻².

3) *Other*: Throughout the measurements with protons, Trikarenos received a total ionizing dose of more than 1.77×10^3 Gy. No degradation in performance or TID-related errors were observed. Furthermore, the observed current consumption remained constant within noise-induced bounds, indicating no SELs.

C. Discussion

1) *Memory Errors*: While the application running may have an impact on the TCLS and total fault rate, the SRAM fault rate checked by the scrubber should not be affected. Comparing neutron and proton fault rates, we observe a $> 9\times$ higher cross-section of the SRAM for neutrons. A precise cause for this requires further investigation but could potentially be attributed to variations in particle types, energy levels, and differences in

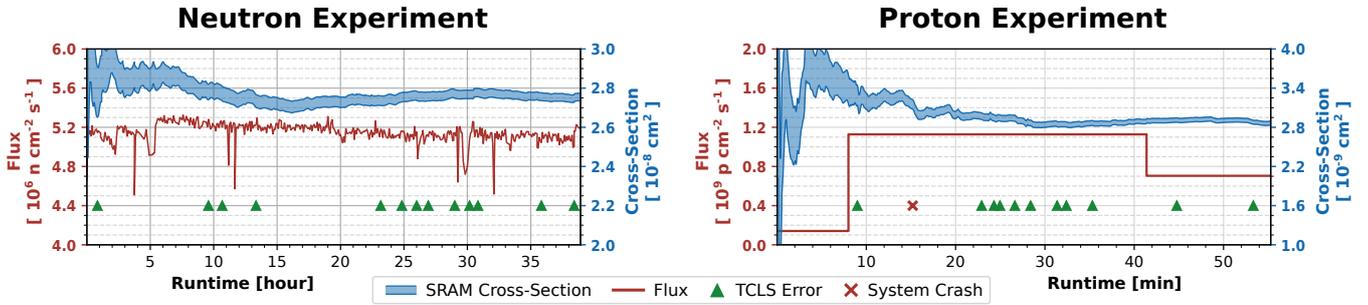


Fig. 3: Visualization of induced errors and flux rates during both radiation tests of Trikenos. We show the cross-sections, flux rates, TCLS errors, and system crashes over time. We use an atmospheric-like neutron beam [6] and 200 MeV protons. For the proton tests, no TID-related degradation was observed.

the devices used across tests. However, this provides an initial foundation for the validity of neutron beam experiments to evaluate the radiation tolerance of new devices, even in other domains.

With SRAM cross-sections of $(1.08 \pm 0.01) \times 10^{-14} \text{ cm}^2 \text{ bit}^{-1}$ for neutrons and $(1.12 \pm 0.01) \times 10^{-15} \text{ cm}^2 \text{ bit}^{-1}$ for protons, we can appropriately tune the scrub rate of the device. Trikenos' scrubber was set to the maximum possible rate for the experiments to ensure all errors were caught without accumulation. This can be reduced to limit power consumption. With individual scrubbers for each of the 8 memory banks, each scrubber is responsible for 8192 words. To ensure the entire memory space is checked between the mean failure rate, the scrubber needs to complete its memory check every 408 ms for the proton test condition, leading to a word check per bank every 6225 cycles.

2) *Core Errors*: In the tested operation mode, Trikenos detects all corruptions within the cores, both those that may lead to system corruption due to an erroneous branch, corrupted pointer or misdecoded instruction, and data corruption.

Operating in Trikenos' independent mode, a performance improvement of up to $2.96\times$ with three cores in parallel or a 35% reduction in core power consumption with a single core is possible. In this independent mode, however, erroneous control flow may lead to stalls that can be caught by a watchdog timer, or SDC can lead to erroneous data. Assuming all faults in a core lead to a system crash, the device cross-section in parallel operation increases by at least $3.5\times$ from $(2.55 \pm 0.68) \times 10^{-11} \text{ cm}^2$ for neutrons and by at least $2.14\times$ from $(5.64 \pm 1.56) \times 10^{-12} \text{ cm}^2$ for protons. For single-core operation, assuming an equal distribution of errors in the cores, the cross-section improvement is at least $1.12\times$ from $(1.08 \pm 0.48) \times 10^{-11} \text{ cm}^2$ for neutrons. Further measurements can help narrow down the improvement, likely showing a significant increase in the reliability factor. Without SRAM protection, the improvement is far more significant, even considering that only a subsection of the memory is used and that some data corruption may not cause a system crash.

The TCLS recovery routine, requiring around 600 cycles or $4.8\mu\text{s}$ at 125 MHz, has a negligible impact on performance for the observed error rates.

3) *Other*: Both the neutron and proton experiments also revealed vulnerabilities in the telemetry registers, showing flips of specific bits reflecting immediate, immense increases in measured error counts. While not critical for performance or operations, such registers or similar SoC control registers may be worth protecting in future designs.

Finally, while unrecoverable errors were very rare in our investigations, it was shown that they are still possible, requiring watchdog circuitry or further protection in future designs. For the Trikenos SoC, their root cause analysis requires further investigation due to their rarity.

V. CONCLUSION

Exposing the Trikenos SoC to neutrons and protons, we observe most errors affecting the SRAM for a cross-section per bit of $(1.08 \pm 0.01) \times 10^{-14} \text{ cm}^2 \text{ bit}^{-1}$ and $(1.12 \pm 0.01) \times 10^{-15} \text{ cm}^2 \text{ bit}^{-1}$ for atmospheric neutrons and 200 MeV protons, respectively, protected by ECC, thus, not affecting the system's function. Trikenos' TCLS mechanism corrects most of the remaining errors, reducing the cross-section by at least $3.5\times$ from $(2.55 \pm 0.68) \times 10^{-11} \text{ cm}^2$ to below $5.36 \times 10^{-12} \text{ cm}^2$, showing TCLS' efficacy and Trikenos' validity for use in critical environments.

REFERENCES

- [1] S. Di Mascio *et al.*, *Computer Science Review*, 2021
- [2] A. Walsemann *et al.*, *Journal of Instrumentation*, 2023
- [3] M. Rogenmoser *et al.*, *IEEE International Conference on Electronics, Circuits and Systems (ICECS)*, 2023
- [4] M. Rogenmoser *et al.*, *ACM Transactions on Cyber-Physical Systems*, 2023
- [5] G. Borghello *et al.*, *Journal of Instrumentation*, 2023
- [6] C. Cazzaniga *et al.*, *Journal of Physics: Conference Series*, 2018
- [7] M. Rovituso *et al.*, *arXiv.org*, 2023
- [8] N. L. Johnson *et al.*, *Univariate Discrete Distributions*, John Wiley & Sons, Ltd, 2005
- [9] V. Vargas *et al.*, *IEEE Transactions on Nuclear Science*, 2017
- [10] M. Gordon *et al.*, *IEEE Transactions on Nuclear Science*, 2004