

Confidence intervals for the encircled energy fraction and the half energy width

Giuseppe Vacanti

cosine Science & Computing BV, Oosteinde 36, 2361 HE Warmond, The Netherlands

June 28, 2021

Abstract

The Encircled Energy Fraction and its quantiles, notably the Half Energy Width, are routinely used to characterize the quality of X-ray optical systems. They are however always quoted without a statistical error. We show how non-parametric statistical methods can be used to redress this situation, and we discuss how the knowledge of the statistical error can be used to speed up the characterization efforts for future X-ray observatories.

1 Introduction

One of the parameters used to characterize the performance of optics is the diameter of the region of the focal plane containing a certain fraction of the total power transmitted by the optics. In X-ray optics the diameter of the disk containing 50% of the photons collected in the focal plane is commonly used, and it is called the Half Energy Width (HEW); at other wavelengths this is known as the Half Power Disk.

The HEW is a key performance indicator of the angular resolution of the optics, and very often it is the only performance indicator used to describe the quality of the optics. Comparisons between different X-ray mirror technologies are also often done solely in terms of achieved HEW.

To our knowledge, nobody ever quotes the statistical error associated with the HEW, nor any confidence band is given when the Encircled Energy Fraction (EEF) is plotted. Still, this is a natural thing

to do when measurement results are reported. Indeed it is almost always the case that the functional form of the point spread function of an optics is not known, and therefore there is no ready-to-use formula that can be applied to bound the experimental values measured. This observation however suggests that a solution to the problem should be looked for in non-parametric statistical methods.

In this article we show that by making use of textbook non-parametric statistics solutions, the statistical error and the confidence interval for a measure HEW value, and the confidence band of the EEF can be easily determined.

The remainder of this article is organized as follows. In § 2 we describe the experimental configuration considered, and recast the notion of EEF in terms of the empirical Cumulative Distribution Function (CDF); once this is done the confidence band of the EEF can be easily calculated. In § 3 we continue mapping terms known in optics to terms used in probability and statistical theory; again this will lead in a straightforward manner to calculate the standard error of the HEW. The logical extension to the calculation of a confidence interval for the HEW is illustrated in § 4. The solutions discussed are illustrated by means of numerical experiments in § 5, and further discussed in § 6. Conclusions are drawn in § 7.

2 Confidence band for the encircled energy fraction

Consider an experimental set up designed to characterize the optical performance of an imaging system. We limit our discussion to a photon counting experiment. Without loss of generality we can limit ourselves to the case where the source of photons is on-axis and monochromatic. Photons are reflected by the optical system and collected at the focal plane with an ideal position-sensitive detector.

For a certain measurement let n be the number of photons detected. Let $\{R_i\}_{i=1\dots n}$ be the distances of the detected photons from the center of the focal plane, the place where a perfect imaging system would image a point source at infinity. The empirical Cumulative Distribution Function (CDF) is defined as

$$\widehat{F}_n(r) = \frac{1}{n} \sum_1^n I(R_i \leq r), \quad (1)$$

where

$$I(R_i \leq r) = \begin{cases} 1 & \text{if } R_i \leq r \\ 0 & \text{otherwise.} \end{cases} \quad (2)$$

It is obvious that the CDF is equivalent to the EEF, and that \widehat{F} is therefore an estimate of the true EEF. That is to say, \widehat{F} is an estimate of the probability that a certain measured radial distance R be less than r :

$$F(r) = P(R \leq r), \quad (3)$$

Once we recognize the nature of the EEF, it is immediately possible to calculate a confidence band for it by invoking the Dvoretzky-Kiefer-Wolfowitz inequality [1], that states that for any $\epsilon > 0$

$$P\left(\sup_r |F(r) - \widehat{F}(r)| > \epsilon\right) \leq 2e^{-2n\epsilon^2}. \quad (4)$$

If we now take [2]

$$\epsilon_n^2 = \log(2/\alpha)/(2n) \quad (5)$$

where $\alpha \in (0, 1)$, and define

$$L(r) = \max\{\widehat{F}_n(r) - \epsilon_n, 0\} \quad (6)$$

and

$$U(r) = \min\{\widehat{F}_n(r) + \epsilon_n, 1\}, \quad (7)$$

by substituting in Equation (4) we obtain

$$P(L(r) \leq F(r) \leq U(r)) \geq 1 - \alpha, \forall r. \quad (8)$$

This equation defines for all r the $1 - \alpha$ confidence band for the EEF. Examples of EEF confidence bands calculated in this manner are shown in Figure 1 (see § 5 for the details).

3 The standard error of the half energy width

By definition the HEW is twice the 2-quantile (the median) of the CDF, formally

$$H = 2F^{-1}(1/2). \quad (9)$$

While the confidence band calculated in the previous section can be used to gain an idea of the uncertainty associated with the estimate of the HEW, Equation (8) cannot be strictly inverted: that is, knowledge of the confidence band of the EEF cannot be used to infer the confidence interval for the HEW. Instead we need to know the variance and the distribution of the HEW. The bootstrap method [3, 4] can be used to arrive at the result.

The bootstrap is a statistical method that derives information about the variance and the distribution of any statistics using only the data available. Textbooks discuss the method in contexts removed from optics: in the following we follow [3] (§ 5), but recast the description in terms commonly use in optics.

Going back to our observed values, $\{R_i\}_{i=1\dots n}$, we proceed as follows.

1. Draw with replacement from the data a new series of radial distances $\{R'_i\}_{i=1\dots n}$.
2. Calculate a new HEW value H' from the new series.
3. Repeat the previous two steps B times to obtain the bootstrap series of HEW estimates $\{H'_k\}_{k=1\dots B}$.

4. The bootstrap variance estimate of the HEW is obtained by calculating the variance of the bootstrap series.

The standard error we are after is the sample standard error of the bootstrap series:

$$\hat{s}e = \sqrt{\sum_{k=1}^B \frac{(H'_k - \bar{H}')^2}{B-1}}, \quad (10)$$

where $\bar{H}' = \sum_k (H'_k/B)$. The issue is now how large B should be in order to provide a sufficiently accurate estimate of the variance. In the literature values of B of the order of 200 are used. However a larger value is required to arrive at a good estimate of bootstrap confidence intervals, as we discuss in the following section.

4 Confidence interval for the half energy width

Once the standard error has been determined, we can make use of other non-parametric techniques to estimate the confidence interval of the HEW. In the literature a number of approaches are available to this end. Here we discuss two of them: the percentile method, and the so-called BC_a method. Both methods make use of percentiles of the cumulative distribution of the HEW bootstrap series, but they differ in the manner in which those percentiles are calculated. We follow [5].

4.1 The percentile confidence interval

The percentile method makes use of the bootstrap series of HEW estimates to calculate the boundaries of the confidence interval. Let \hat{G} be the empirical CDF of the bootstrap series $\{H'_k\}_{k=1\dots B}$ obtained above. The $1-\alpha$ percentile confidence interval for the HEW is delimited by the two percentiles of \hat{G} , $\hat{G}^{-1}(\alpha/2)$ and $\hat{G}^{-1}(1-\alpha/2)$. It is important to note that the confidence interval obtained will not necessarily be centered on the HEW estimate.

This method is straightforward to implement, requires B to be of the order of 2000, and makes the

assumption that the bootstrap distribution is an unbiased realization of the true HEW distribution.

With a bit more work one can generate a better confidence interval, better meaning that its coverage of the real confidence interval is more accurate. In the following section we describe how this is done.

4.2 The BC_a confidence interval

With the BC_a (bias-corrected and accelerated) method the extremes of the confidence interval are again based on two quantiles of the bootstrap CDF, but these are calculated in a manner that ensures that the resulting confidence interval has a higher probability of overlapping with the true one.

The two quantiles used are:

$$\alpha_1 = \Phi\left(\hat{z}_0 + \frac{\hat{z}_0 + z^{(\alpha)}}{1 - \hat{a}(\hat{z}_0 + z^{(\alpha)})}\right) \quad (11)$$

$$\alpha_2 = \Phi\left(\hat{z}_0 + \frac{\hat{z}_0 + z^{(1-\alpha)}}{1 - \hat{a}(\hat{z}_0 + z^{(1-\alpha)})}\right), \quad (12)$$

where $\Phi(\cdot)$ is the Normal CDF, and \hat{a} and \hat{z}_0 are two constants that must be computed from the data. How is explained in detail in § A.

5 Numerical experiments

We illustrate the issues discussed in this article with the results of numerical simulations.

We consider the case of optics that have a point spread function that can be represented as a circular bivariate Normal:

$$p(x, y) = \frac{1}{2\pi} e^{-\frac{1}{2}(x^2+y^2)}. \quad (13)$$

The HEW corresponding to this function can be calculated analytically and is

$$\text{HEW} = 2\sqrt{2 \ln 2} = 2r_{50}, \quad (14)$$

where $r_{50} \approx 1.177$ is the median of the radial distribution obtained from Equation (13).

In Figure 1 we show the 90% confidence bands calculated with Equation (4) for two realizations of Equation (13) containing 100 and 1000 photons

respectively. As can be expected the confidence band becomes narrower as the number of photons increases. Note how relatively few photons are sufficient to tightly bound the EEF.

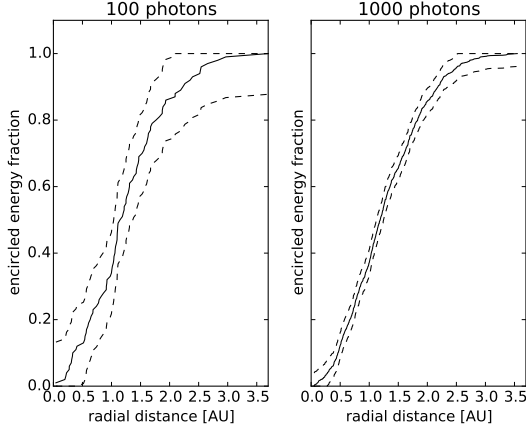


Figure 1: Two realizations of the 90% confidence band of the encircled energy fraction for an imaging system with a point spread function equal to a bivariate circular Normal. As can be expected, the confidence band narrows around the measured data with increasing number of photons.

In a second numerical experiment, we have randomly drawn 500 photons according Equation (13). For each of the 5000 realization we have calculated a new HEW, and the distribution of HEW values is shown in Figure 2: this is meant to represent the underlying true distribution of HEW measurements. Another 500 photons were then drawn at random to represent the measured data, and this latter dataset is used to calculate the measured HEW and the corresponding BC_a 90% confidence interval, also shown in the figure. This example illustrates how the distribution is indeed centered on the true value of the HEW (Equation (14)), but that the bootstrap confidence interval, while obviously not perfectly centered on the underlying distribution, does indeed give a good indication of the statistical uncertainty associated with the result.

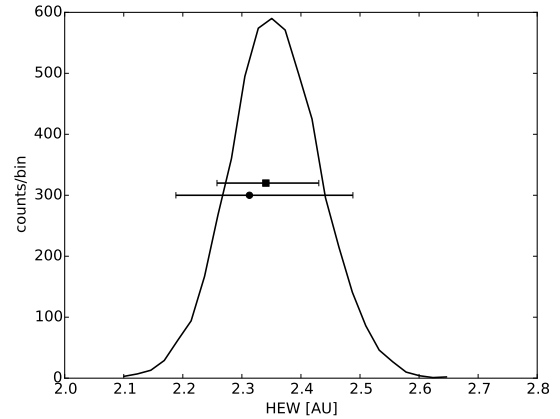


Figure 2: Simulation of a 500-photon measurement of a bivariate circular Gaussian point spread function. The curve shows the true HEW distribution, obtained by simulating 5000 measurements. Also shown the result of one measurement, with the 90% confidence interval calculated with the BC_a method and $B = 2000$. The exact HEW is about 2.35 (Equation (14)).

As a final check on the validity of the approach, we remark that for a bivariate circular Normal the radial values are distributed according to the Rayleigh distribution, for which each quantile and its confidence intervals can be calculated [6]. The HEW calculated in this manner is also shown Figure 2, together with its 90% confidence interval. The two intervals are in good agreement, even if the confidence interval calculated analytically is smaller; this can be easily understood because analytical methods make often use of the knowledge of the distribution to arrive at an unbiased estimator of minimum mean squared error. However, when the distribution is unknown this example show that the bootstrap method arrives at a reasonable estimate of the true confidence interval.

6 Discussion

We have introduced methods to calculate the confidence band of the EEF and the confidence interval of the HEW. The bootstrap method for the computation of the confidence interval can be applied to any measurement, but for the results to be representative of the true HEW confidence level, the data must be taken in such a manner that they randomly sample the point spread function of the optics. This is certainly the case for full flood illumination measurements: then any part of the aperture has the same probability of being probed by X-ray photons, and the methods discussed here can be applied straightforwardly. One could implement the method at a facility so that the statistical accuracy reached by a measurement can be assessed on-line, and the measurement stopped when a predefined accuracy is arrived at. It is our opinion that in many cases this would lead to a reduction of the required measurement time without any loss of measurement accuracy.

We have assumed an ideal detector, or at least one with infinite spatial resolution. Real detectors will in general be pixellated, and may have to be read out at regularly intervals, so that the signal in each pixel is proportional to the number of photons detected. In this case the method can be applied by replacing

Equation (1) with

$$\hat{F}_n(r) = \frac{1}{\sum_1^n p_i} \sum_1^n p_i I(R_i \leq r), \quad (15)$$

where p_i is the number of photons detected by the i^{th} pixel, and R_i is now the radial distance of the pixel from the optical axis.

Not all measurement methods sample the aperture of the optic uniformly, and therefore the application of the bootstrap method requires that changes be made to the way data are collected. Consider for instance the characterization of Silicon Pore Optics (SPO) at the X-ray Pencil Beam Facility of the BESSY-II synchrotron [7]. The SPO have an aperture that is close to rectangular, and they are sampled with an X-ray pencil beam following a rectangular grid. This sampling strategy does not cover the aperture uniformly, and therefore it would have to be changed so that the pencil beam probes the optics aperture at random positions. Also in this case the ability to assess the statistical error on the measured HEW is likely to deliver a significant advantage in terms of measurement time.

In the case of optics built by assembling hundreds of individual X-ray optics, like the Athena mission [8], the methods presented here can be used to screen each individual module to a certain accuracy before deciding whether they should be characterized further and how they should be eventually integrated in the larger telescope assembly.

More in general, making measurement results available with a statistically meaningful estimate of their significance can only be seen as useful pursuit, and it is hoped that the techniques described in this article may encourage the use of statistical errors when reporting HEW results.

7 Conclusions

The characterization of the optical properties of X-ray optics makes use almost exclusively of the EEF and one of its quantiles (HEW). These are always reported without any mention of a confidence band or confidence interval. We have shown that straightforward non-parametric statistical methods provide

ways to place a confidence band around the EEF, and a confidence interval around the HEW.

A Calculation of the BC_a parameters

In this section we show how the parameters required in the calculation of the BC_a are arrived at. For the details refer to [3]. We consider here the original sample $\vec{R} = \{R_i\}_{1..n}$ and a statistics of interest $\hat{\theta} = s(\vec{R})$ (in our case this would be the median or the HEW).

The parameter \hat{z}_0 in Equation 11 is called the bias correction, and is obtained from the proportion of bootstrap estimates smaller than the original estimate:

$$\hat{z}_0 = \Phi^{-1} \left(\frac{\#\{\hat{\theta}' \leq \hat{\theta}\}}{B} \right), \quad (16)$$

where $\Phi(\cdot)$ is the Normal CDF.

The acceleration parameter \hat{a} can be calculated in terms of the jackknife values of the statistics $\hat{\theta}$. Let $\vec{R}_{(i)}$ be the original sample with the i -th point removed, $\hat{\theta}_{(i)} = s(\vec{R}_{(i)})$, and $\hat{\theta}_{(\cdot)} = \sum_1^n \hat{\theta}_{(i)}/n$. The acceleration parameter is

$$\hat{a} = \frac{\sum_1^n [\hat{\theta}_{(\cdot)} - \hat{\theta}_{(i)}]^3}{6\{\sum_1^n [\hat{\theta}_{(\cdot)} - \hat{\theta}_{(i)}]^2\}^{2/3}}. \quad (17)$$

References

- [1] P. Massart. The Tight Constant in the Dvoretzky-Kiefer-Wolfowitz Inequality. *The Annals of Probability*, 18(3):1269–1283, jul 1990.
- [2] Larry Wasserman. *All of Nonparametric Statistics*. Springer New York, 2006.
- [3] B. Efron and R. J. Tibshirani. *An Introduction to the Bootstrap*. Chapman and Hall/CRC, 1994.
- [4] B. Efron. Bootstrap Methods: Another Look at the Jackknife. *The Annals of Statistics*, 7(1):1–26, jan 1979.
- [5] B. Efron. Better Bootstrap Confidence Intervals. *Journal of the American Statistical Association*, 82(397):171–185, mar 1987.
- [6] M. M. Siddiqui. Statistical inference for rayleigh distributions. *Journal of Research of the National Bureau of Standards, Sec. D*, 68, 1964.
- [7] G. Vacanti, M. Ackermann, M. Vervest, M. Collon, R. Günther, C. Kelly, E. Wille, L. Cibik, M. Krumrey, and P. Müller. X-ray pencil beam characterization of silicon pore optics. In *Society of Photo-Optical Instrumentation Engineers (SPIE) Conference Series*, volume 8861 of *Society of Photo-Optical Instrumentation Engineers (SPIE) Conference Series*, page 1, September 2013.
- [8] Marcos Bavdaz, Max Collon, Marco Beijersbergen, Kotska Wallace, and Eric Wille. X-Ray Pore Optics Technologies and Their Application in Space Telescopes. *X-Ray Optics and Instrumentation*, 2010(15), 2010.