

IAC-24-E2,4,1,x89777

The On-board Computer of the AcubeSAT mission

Konstantinos Tsoupos¹
ktsoupos@ece.auth.gr

Grigorios Pavlakis¹
grigpavl@ece.auth.gr

Lily Ha⁴
lily.ha@ext.esa.int

Stylios Tzelepis⁵
tzelepissteli@gmail.com

Panagiotis Bountzioukas^{6,1}
panagiotis.bountzioukas@ext.esa.int

David Palma³
David.Palma@esa.int

Georgios Sklavenitis¹
gsklaven@ece.auth.gr

Christina Athanasiadou¹
athanchris@ece.auth.gr

Loris Franchi⁶
Loris.Franchi@ext.esa.int

Dimitrios Stoupis^{1,2}
dstoupis@auth.gr

Prof. Alkis Hatzopoulos¹
alkis@ece.auth.gr

¹: Aristotle University of Thessaloniki, Thessaloniki, Greece

²: Center for Mind/Brain Sciences (CIMEC), University of Trento, Rovereto, Italy

³: European Space Agency, ESTEC, Noordwijk, Netherlands

⁴: HE Space Operations for European Space Agency, ESTEC, Noordwijk, Netherlands

⁵: National Technical University of Athens (NTUA), Greece

⁶: Redu Space Services for European Space Agency, ESEC, Redu, Belgium

Abstract

The architecture of the On Board Computer (OBC) subsystem for CubeSats is naturally evolving, characterized by the integration of low-power, lightweight components, cutting-edge microprocessors harnessing multiprocessor or heterogeneous computing, and sophisticated algorithms enabling autonomous operation in increasingly compact platforms.

Despite the ongoing standardization efforts within the space community, the unique payload requirements of the AcubeSAT mission, an open-source nanosatellite that aims to probe the effects of radiation and microgravity on eukaryotic cells in Low Earth orbit (LEO) within the FYS3 program of the European Space Agency (ESA) Education Office, necessitated the development of a custom, cost-effective module. This module shall not only meet the spatial and functional demands of the mission but also serve as an educational tool, providing valuable hands-on experience to project members involved in designing space-grade equipment and developing critical system software that follow the European Cooperation for Space Standardization (ECSS) Standard.

The single Printed Circuit Board (PCB) hosts two distinct subsystems: one resembling a conventional OBC responsible for telecommand execution, telemetry fetching, onboard time synchronization, in-orbit patching, and Fault Detection Isolation and Recovery (FDIR). The second entails the implementation of an Attitude and Orbit Control System (AOCS) for both nominal and downlinking scenarios, facilitating a directional patch antenna for payload data transmission. The hardware for each subsystem resides on separate sides of the PCB and includes non-volatile memories for critical data and telemetry storage, custom radiation-tested Latch-up Current Limiter (LCL) protection circuits, sensors, interfaces with the Payload Subsystem, the actuators and the rest of the in-house and Commercial of the Shell (COTS) components, all while maintaining compatibility with the LibreCube standard. At the core of each subsystem lies a Radiation Tolerant Advanced RISC Machines (ARM) Cortex-M7 MCU. This architecture not only decentralizes processing power, mitigating single points of failure but also leverages redundancy capabilities.

This paper aims to elucidate the decision-making process, design iterations, and development stages of the custom board and accompanying in-house software. Insights garnered from the initial partially successful environmental test campaign at the ESA CubeSat Support Facility (CSF) will be shared, along with the ensuing preparations, results, and lessons learned from subsequent testing endeavors in April 2024. Furthermore, the current developmental status will be discussed alongside future Electromagnetic Compatibility (EMC) testing, integration plan on a FlatSat, and prospects for the open-source design as a cost-effective, and modular solution that can be tailored with little effort for upcoming missions.

Keywords: cubesat, testing, design, FYS, on-board computer

1. Introduction

AcubeSAT is an open-source Space biology project supported by the 3rd cycle of the Fly Your Satellite! programme of the ESA Education Office, with a dual objective; first, it aims to probe changes in gene expression in eukaryotic cells when exposed to the effects of microgravity and radiation in Low-Earth Orbit. Second, it seeks to introduce a Lab-on-a-Chip (LoC) platform as a modular and cost-effective method for conducting high-throughput Space biology research. Beyond the scientific goals, SpaceDot, the team that is developing AcubeSAT, as an interdisciplinary Space research team of the Aristotle University of Thessaloniki, aspires to promote aerospace engineering as an accessible field of study within the academic community in Greece [1].

Throughout the development, the team focused on creating a custom On-Board Computer subsystem that would meet the unique needs of the mission, while ensuring reliability in the harsh Space environment [2]. This paper outlines the journey, from the initial design stages to the rigorous testing of the PCB, highlighting key milestones, performed tests, and lessons learned along the way. A high-level timeline is illustrated in Figure 1.

2. Design Phase

2.1 History & Background

Designing AcubeSAT's custom OBC marked one of the team's first ventures into embedded systems development. The STM32L4S9ZIT6 Microcontroller Unit (MCU) from the STM32 series was initially chosen as the core of the subsystem, primarily due to the team's familiarity with the platform and its suitable peripheral set that satisfied the mission requirements [3]. As reliability is paramount for a critical subsystem such as OBC, a dual, cold-redundant MCU setup was selected.

However, due to space constraints and complexity the cold-redundant architecture was abandoned for a simpler design with a single MCU. *Microchip's (Amel) SAMV71Q21RT* [4] was the new chip replacing the old STM32-based design, because of its low cost, resistance to radiation effects (as it has a drop-in pin-compatible radiation-tolerant version available), and similarity in the feature set with the previous MCU. Since this design change, the SAMV71Q21RT has continued to serve as the primary processing unit for the subsystem up to the present day. This processor is also employed across some other in-house built subsystems, including the Payload PCB and the Attitude, Determination and Control Subsystem (ADCS). By standardizing on the SAMV71Q21RT, decentralized processing power is achieved to meet the computational requirements of each subsystem individually, while also reducing the software development overhead and preserving

robustness due to the radiation hardness of the MCU.

At the hardware implementation level, a single PCB, that follows the LibreCube Board Specification [5], seen in Figure 3, hosts two distinct subsystems. One resembling a conventional OBC responsible for telecommand execution, telemetry retrieval, on-board time synchronization, in-orbit patching [6], and system-level FDIR [7]. The second subsystem entails the implementation of an ADCS for both nominal and downlinking scenarios [6, 8]. The two subsystems have their own dedicated SAMV71Q21RT MCU, for a more distributed processing power and reliability. The decision to combine both subsystems onto a single PCB was driven by space constraints. From this point forth, the PCB hosting the two subsystems will be referred to as the OBC/ADCS board, with each subsystem referred to as the OBC side and the ADCS side, respectively.

Software-wise, an early decision was taken to extensively use modern C++17 for the development of the system firmware [9], in order to exploit the extensive compile-time type safety checks [10] provided by the language standard. The team deliberately eschewed features such as dynamic memory allocation, multiple inheritance, virtual functions, and the default C++ Standard Template Library (STL), preferring to replace it with an embedded-friendly implementation, namely ETL [11], in order to reduce the binary size and make memory allocation behaviors more predictable. As the complex nature of such a control software requires multiple tasks that need to run in parallel, FreeRTOS [12] was selected as the operating system as it natively supports the ARM Cortex-M7 architecture which is the core of the SAMV71Q21RT MCU [13]. The software source files can be found in the project's open repositories for OBC [14] and ADCS [15].

The system level design philosophy consists of the Integration Model (IM) (flatsat) and the Proto-flight Model (PFM) (assembled spacecraft) [16]. Every procured subsystem component initially integrated into the IM. Specifically for the OBC/ADCS board, the design approach includes the production of a Development Model (DM), an Engineering Qualification Model (EQM) and finally a Flight Model (FM) [16].

2.2 System Architecture

The OBC is responsible for the reliable management of information flow throughout the entire spacecraft's system [3] and it's built around the hardware specification seen in Table 1a.

The chosen MCU has a drop-in pin-compatible replacement non-tolerant version that is used for development purposes, thus reducing production costs for experimentation [17]. Data storage for mission-critical paramet-

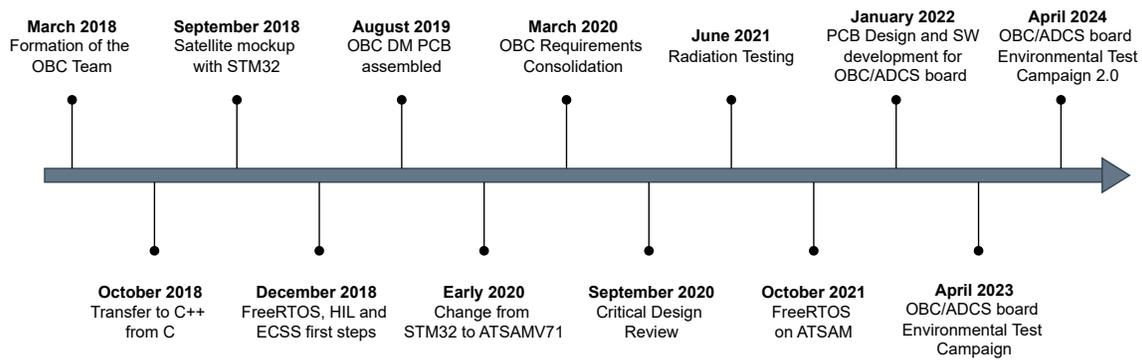


Fig. 1: High-level timeline with the key milestones of the OBC subsystem.

ers is supported by 2 MB of Magnetoresistive Random Access Memory (MRAM) [18], selected for its inherent immunity to Single-Event Upset (SEU)s [19], while non-critical data (e.g. telemetry) are stored in a 4 GB automotive-grade NOT-AND (NAND) Flash [20]. A brief high-level diagram of the OBC subsystem architecture is depicted in Figure 2.

Given the satellite’s prolonged exposure to ionizing radiation, safeguarding critical electronics is essential. To enhance their resilience in these harsh conditions, the team developed custom in-house LCL circuits. These circuits were specifically designed to protect the most vital components of the OBC, the two memory modules and the Control Area Network (CAN) transceivers, from Single-Event Latch-up (SEL).

The functions of the ADCS subsystem serve to control the spacecraft’s angular velocity within safe limits, pointing during payload data transmission, in addition to sun pointing for maximal power input. To achieve that, the MCU is connected to a series of sensors that aid in the estimation of the spacecraft’s orientation and angular velocity, driving the required actuators for control [8]. The main components that constitute the ADCS can be found in Table 1b.

All satellite PCBs, excluding the Payload Subsystem, are connected through a stack configuration using LibreCube-compatible PC104 connectors [5]. The 104-pin connectors provide flexibility, ensuring compatibility with various Open-Source and Commercial of the Shell (COTS) hardware modules. Communication between the OBC and ADCS subsystems, as well as with other spacecraft systems, is facilitated through the CAN Flexible Data Rate (CAN-FD) bus, which operates with a custom signaling protocol [6] that transports messages according to the ECSS Packet Utilization Standard (PUS) standard [21]. The bus is cold-redundant, ensuring inter-subsystem com-

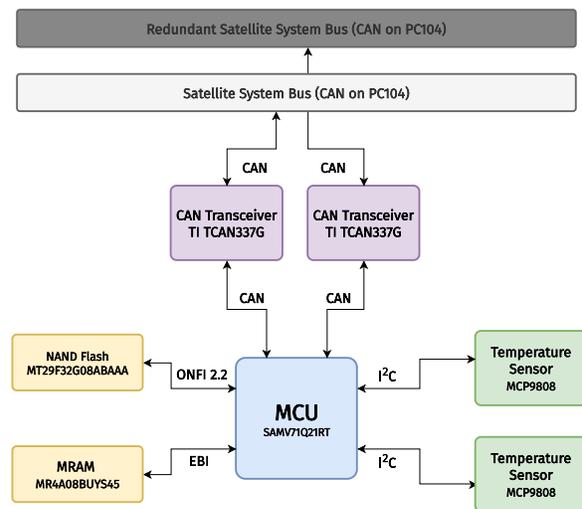


Fig. 2: High level diagram of the OBC board physical architecture. The letter and number sequence below the names in each block represents the part number of the respective component.


munication in case of failure. The SatNOGS Communications subsystem [22], which is part of the satellite, is fully compatible with this design. CAN-FD, along with the transceiver specified in Table 1a, was selected for compatibility with the SatNOGS but also for its built-in protection features, including overvoltage and Electrostatic Discharge (ESD) safeguards [23].

2.3 Manufacturing


The OBC/ADCS PCB was entirely designed using the KiCad open-source EDA tool [30], with the design files available in the project’s GitLab repositories [31]. The PCB features an 8-layer design, including two layers dedicated to components and signal routing, three for ground

Table 1: Subsystem hardware specification of the OBC and ADCS. The first column in each table shows the component’s function and the second column shows the details, like the part number.

(a) OBC hardware specification		(b) ADCS hardware specification	
MCU	SAMV71Q21RT, (ARM Cortex-M7 @ 300 MHz) [4]	MCU	SAMV71Q21RT, (ARM Cortex-M7 @ 300 MHz) [4]
Spacecraft bus	2x Texas Instruments TCAN337G CAN Transceiver [23]	Spacecraft bus	2x Texas Instruments TCAN337G CAN Transceiver [23]
Critical data storage	Everspin MR4A08BUYS45 MRAM, 2 MB [18]	Sun-Spacecraft Orientation Angular Acceleration	Coarse Sun Sensors Magnetorquers ISIS iMTQ [26]
Ambient sensing	2x Microchip MCP9808 Temperat- ure Sensors [24]	Ambient sensing	2x Microchip MCP9808 Tem- perature Sensors [24]
Main storage	Micron MT29F32G08ABAA NAND Flash, 4 GB, SEE data available [20]	Angular Acceleration	Reaction Wheel RW210 [27]
Active SEL countermeasures	In-house-designed LCLs	Angular sensing	3x Gyroscopes ADXRS453BEYZ (X,Y,Z Axes) [28]
Protection Circuit	Overvoltage, Under- voltage and Reverse Surge Protector LTC4367 [25]	Earth magnetic field sensing	3-axes Magnetometer RM3100 [29]
		Protection Circuit	Overvoltage, Under- voltage and Reverse Surge Protector LTC4367 [25]

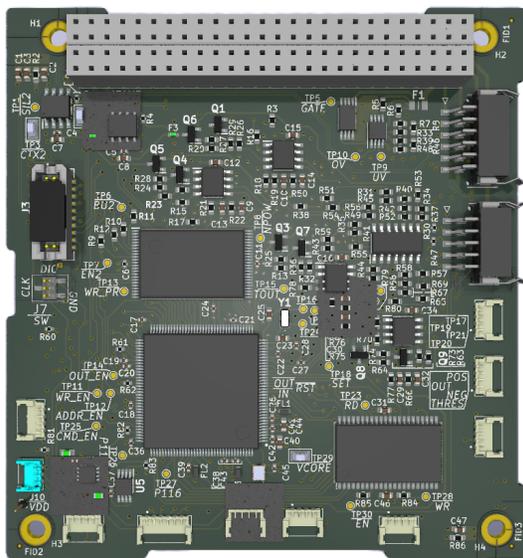

(a) OBC side, top layer

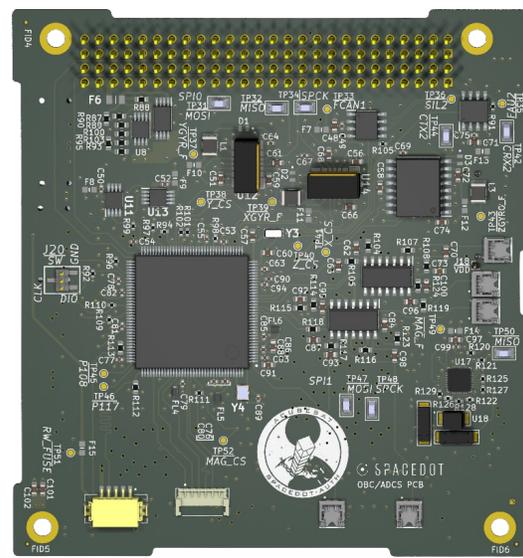

(b) ADCS side, bottom layer

Fig. 3: OBC/ADCS board render with all components layed out. The top layer hosts the OBC subsystem (a) and the bottom layer the ADCS (b).

planes, and one for power distribution. The components, corresponding to the OBC and ADCS subsystems, are placed on opposite sides of the PCB and are electrically isolated through the ground layers to prevent interference. The multi-layer structure also provides additional resilience against extreme vibrations.

The PCB was manufactured by Eurocircuits and assembled by **Prisma Electronics S.A***. The solder and flux types used are Sn63Pb37, Type K/3.5% ROL0, specifically SAC305 and PF7723, according to the ECSS soldering standards [32], optimized for Space applications to ensure robustness under extreme temperature conditions.

2.4 Subsystem Space Validation

Given the hostile conditions of the Space environment, it is essential to expose satellite modules to similar conditions early in the development process to validate their performance. As mentioned earlier in Section 2.2, the radiation levels in LEO necessitate testing the radiation tolerance of key components. To address this, a dedicated radiation testing campaign was conducted at the Heavy Ion Testing facility at UCLouvain, as detailed in Section 3.

In addition to radiation tolerance, the PCB must endure the mechanical stresses of the launch and extreme temperature effects. Thermal Vacuum Chamber (TVAC) testing, along with vibration tests, play a critical role in ensuring the board's durability and overall mission success. The team performed two environmental test campaigns at ESA's CubeSat Support Facility at European Space Security and Education Centre (ESEC)-Galaxia in Belgium. These tests provided valuable insight in the functionality of the board, which is discussed in detail in Section 4.

Currently, the team is actively refining both the hardware and software of the OBC/ADCS board, drawing on insights from these environmental tests and ongoing assessments under ambient conditions. Debugging and iterative development are helping address the challenges identified during testing.

The following sections present the key results of these testing campaigns, along with the lessons learned and the troubleshooting efforts undertaken to enhance the system's robustness.

3. Radiation Effect Mitigation

To enhance the reliability of the OBC/ADCS board, the team adopted a specific design approach focused on mitigating radiation effects. Protective measures and redundant circuitry following the identification of the critical systems have been implemented (as mentioned in Section 2.2). The team opted to use COTS components, aligning with the

New Space industry trend, a decision that also significantly reduced the costs of the in-house OBC/ADCS board models.

The component selection followed a common pipeline of creating a database and gathering existing information online, with respect to Total Ionizing Dose (TID) and Single-Event Effect (SEE) radiation immunity levels. The approach taken was the addition of a radiation design margin of at least 1.2 (as mentioned in the ECSS policy for design margins [33]) to account for any uncertainties concerning the simulated values, as well as, any extra degradation, rendering components more prone to radiation effects. It should be noted that the Total Ionizing Dose (TID) levels were simulated with the TRAD's FASTRAD [34] simulation tool by using the full Computer-aided design (CAD) of the satellite and the orbital data as input [1]. The simulated levels for the mission duration were found to be well within the Radiation Design Margin (RDM) limits. To increase the reliability and tackle possible issues connected to the STM micro-controllers (SEE sensitivity), the team decided to use a radiation-tolerant MCU for the FM and the equivalent model non-radiation hardened version for the EQM.

Certain components identified as critical, with missing radiation-related data, were screened for SEE effects during the Heavy Ion Testing at UCLouvain. The main focus of the testing was on SELs, given their potentially destructive nature [33]. Before testing the components, the protective cover was removed through a process called delidding. With the help of the EEE (Electrical, Electronic and Electro-mechanical) components lab of ESTEC [35], part of the casing was eliminated so that the die could be directly exposed to the Heavy-Ion beam. After the delidding process, the components were soldered on a dedicated testing board.

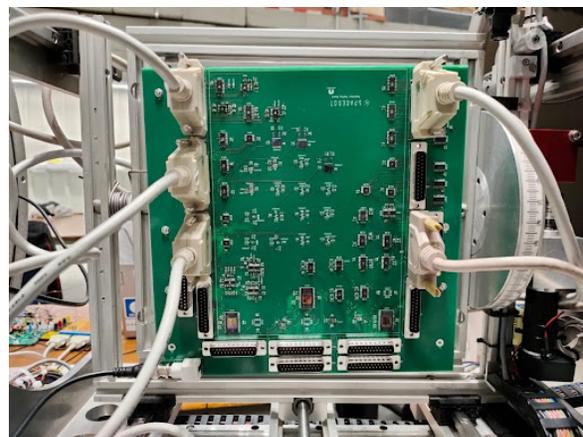


Fig. 4: Heavy ion testing board with all the components soldered

*<https://www.prismaelectronics.eu>

The initial list of components identified included the MRAM [18], the CAN Transceiver [23], the 555 timer (TLC555QDRQ1) [36], the shift register (SN74HC595DR) [37], the Operational Amplifier (TLV2254AIDR) [38], the NOR Gate (CD74HC02ME4) [39] and the S-R Latch (CD4044BD) [40].

The final version of the in-house LCL-hosted parts that were tested in the Heavy-Ion (HI) campaign. The LCL development board was also used during the campaign as part of the Electrical Ground Support Equipment (EGSE), resulting in both the validation of the functionality of the board and the qualification of the individual components. The key takeaway from this testing campaign was the absence of SELs for every tested component. Due to time constraints and hardware issues, the memories were not tested. CAN transceivers were also tested for a short period of time, during which, Single Event Transients (SETs) and Single Event Upsets (SEUs) were observed.

4. Environmental Testing Campaigns

The two Environmental Testing Campaigns with a single EQM model of the AcubeSAT OBC/ADCS board design serving as the Device Under Test (DUT) were conducted at the ESA CSF, ESEC-Galaxia, Transinne, Belgium [41]. The campaign consisted of Vibration and TVAC testing. The detailed Test Specifications and Test Reports can be found in the relevant Test Specification & Test Procedures (TSTP) documents [42, 43, 44, 45].

4.1 Tests Configuration

4.1.1 Vibration Testing Description

In accordance with the "Test as you Fly, Fly as you Test" testing principle, vibration testing took place before TVAC tests. During the vibration testing the DUT underwent on each axis a Resonance Search to identify the natural frequencies of the DUT, followed by a Random Vibration test and a post Resonance Search to verify structural integrity by observing minimal frequency and amplitude shifts in the frequency response. Three main measurement accelerometers were used. Two of them were placed on the ADCS side, one on top of the MCU where the maximum effects of the loading are expected, and one near the corner of the PCB. The third accelerometer was placed on the metal adaptor used for the mounting on the shaker, along with two control accelerometers.

4.1.2 TVAC Testing Description

The TVAC testing includes four thermal cycles due to time constraints. One is non-operational, where the DUT is turned off, and three are operational where the DUT must withstand temperature fluctuations while being operational. Its functionality is confirmed through functional

tests, either at the maximum temperature point or correspondingly at the minimum. The placement of the thermocouples is designed to capture the thermal response of essential components on both the OBC and ADCS sides of the board and also takes into account the need for adequate surface area to securely tape down both the thermocouples and the associated cables.

4.2 Environmental Testing Requirements

The preparation and execution of an environmental testing campaign for the OBC/ADCS board must adhere to the system and subsystem requirements outlined in the Verification Control Document (VCD)s [46, 47]. The test campaign ensures the board's capability to function reliably in space conditions by verifying compliance with performance, equipment, and environmental standards. Additionally, the testing facilities must meet CubeSat team standards, such as using appropriate thermal and vibration testing equipment under controlled conditions. Moreover, the unique demands of each environmental test—such as ensuring the board's functionality is not impacted—are verified through functional tests. The campaign requirements are specified in the relevant TSTP documents [42, 43, 44, 45].

4.2.1 Vibration Testing Requirements

The vibration testing requirements aim to ensure that the PCB can endure mechanical stresses without functional degradation, with a particular focus on assessing its structural integrity and preventing damage. The philosophy also prioritizes careful monitoring through resonant searches and visual inspections to detect any potential weaknesses. Additionally, precision in the placement and mounting of measurement tools, such as accelerometers, is critical to maintaining the reliability and accuracy of the test results.

4.2.2 Thermal Vacuum Testing Requirements

The TVAC requirements are driven by the philosophy of replicating the harsh conditions of space to ensure that the board can perform reliably in extreme thermal and vacuum environments. There is an emphasis on maintaining functional integrity across a wide temperature range and ensuring that the equipment can operate under stressful thermal conditions.

4.3 First Campaign

4.3.1 Vibration Testing Results

During all sequences, there were amplitude shifts in the pre and post-random Resonance searches. The amplitude shift on the X axis was attributed to the natural settling of the DUT, the other shifts were negligible as elaborated

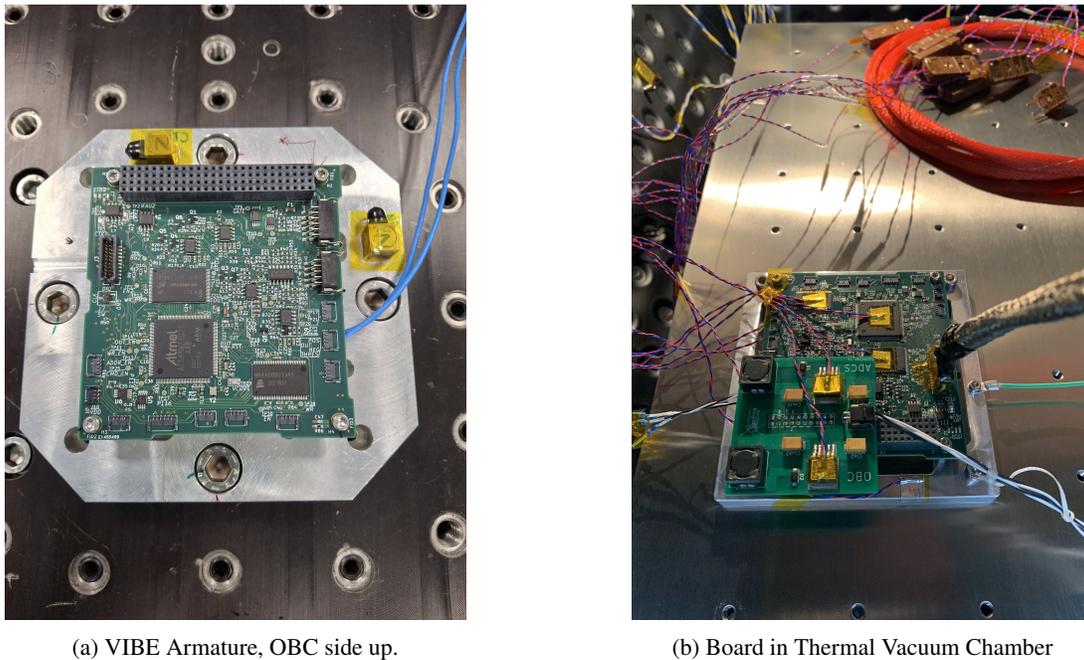


Fig. 5: OBC/ADCS board with all sensors attached for the VIBE and TVAC tests.

in [48]. After the tests, the DUT functionality remained unimpaired. As a result, the testing process was deemed successful. The pass-fail criteria specified were all met for the tests conducted and the team considers the OBC/ADCS board Vibration (VIBE) qualified.

4.3.2 Thermal Vacuum Testing Results

During TVAC testing, after pumping down and before performing any thermal cycling, it was observed that the OBC MCU kept resetting at a random period and the MCU was also informed about Control Area Network (CAN) bus errors. This anomaly occurred at approximately 40 °C and functionality recovered after the temperature dropped.

After software debugging at the CSF [48] during a high-temperature stimulation with a heat lamp, the cause of the crash was determined to be the communication between the MCU and the MRAM along with the over-clocking of the MCU due to the external 16 MHz Temperature - Compensated Crystal Oscillator (TCXO) that was outputting a frequency of 304 MHz for the CPU clock instead of the nominal 300 MHz. This was also causing the CAN errors.

When the board was subjected to sub-zero temperatures, none of the measurements were negative and, instead, had an offset of around 30 degrees over the chamber's temperature, indicating an issue in the logic concerning negative values included in the implementation of the driver. Furthermore, the ADCS MCU experienced a circumstan-

tial crash, occurring at -20 °C but was reset by the internal watchdog and continued to function normally. During the second cold cycle, the team attempted to underclock the MCU due to the use of a TCXO crystal that differed from the one intended for the FM. Although the issue reoccurred, the MCU failed to recover and remained in an idle state. It is important to note that while the board was in the TVAC, the team was unable to debug or upload code due to Ground Support Equipment (GSE) issues, which limited the ability to troubleshoot in real-time.

Following the TVAC test, all electronics and circuitry remained operational as verified through the FTs. The Product Assurance aspect of TVAC testing is considered successful and the manufacturing and assembly processes are considered to be verified. Nevertheless, functionality in extreme temperatures and vacuum is ultimately not reliable and the OBC/ADCS board is not TVAC qualified.

4.4 Design Improvements Based on First Campaign

After the first campaign, four Non - Conformance Report (NCR)s were filled, indicating problems with the temperature sensors software [49], MCU crashes at high temperatures [50], communication failures via the CAN Bus at elevated temperatures [51], and the unresponsiveness of the ADCS MCU at low temperatures [52]. Each of these issues was systematically addressed through targeted design modifications, which were subsequently validated through rigorous testing.

4.4.1 Temperature Sensor Software Malfunctions

The driver caused the external temperature sensors to show unreliable temperature values. More specifically, when the temperature went below 0 °C, none of the measurements were negative and, instead, had an offset of around 30 °C over the chamber's temperature. The error was induced by a fault in the logic concerning negative values included in the implementation of the driver. Modifications in the driver's software successfully resolved the issue as verified by subsequent tests using an MCP9808 [24] evaluation board.

4.4.2 MCU Crashes at High Temperatures

A significant issue identified during testing was the recurrent crashing of the OBC MCU under elevated thermal conditions. The analysis in the CSF revealed that this instability derived from the use of an Resistor Capacitor (RC) circuit-based clock, which lacked sufficient thermal stability, the overclocking of the MCU due to the higher frequency TCXO and the MRAM's operations. To mitigate this, the RC circuit-based clock was replaced with a 12 MHz TCXO which offers greater reliability in extreme temperatures and produces an expected output frequency to the MCU clock. In addition, the MRAM read and write timing cycles were optimized via Static Memory Controller (SMC) configuration.

The performance of the system following these changes improved markedly. The MCU remained operational up to 49 °C, significantly extending its tolerance to high temperatures. Furthermore, isolation heat tests confirmed that the failure was component-related and originated from the MCU, as heating the MCU alone caused it to fail at an internal temperature of 67°C and an ambient of 46 °C, while the MRAM and other components remained stable for temperatures above 50 °C. Subsequent heat tests on another breakout module and an OBC EM board, both having similar functionality and architecture, showed stable performance. Upon replacing the defective OBC MCU on the OBC/ADCS Board, the issue was fully resolved, with no further crashes observed during the ensuing thermal testing.

4.4.3 CAN Bus Failures

Errors were occurring on both the OBC and ADCS during communication over the CAN Bus when the temperature was over 52 °C. In either case, as the temperature further deviated from ambient, communication was automatically halted as neither side could successfully transmit or receive messages. The team was forced to use the internal RC clocks on both MCUs since the TCXO crystal differed from the one that was intended to be used, due to supply chain issues at the time of the EQM manufactur-

ing. After replacing the TCXO crystal to match the FM configuration, the clock output was within the datasheet's [53] specification of a 2.5 ppm tolerance anywhere in the operating range from -40 °C to +85 °C. The communication integrity was restored, with the CAN Bus functioning reliably during high-temperature tests.

4.4.4 ADCS MCU Unresponsiveness at Low Temperatures

At low temperatures, the ADCS MCU became unresponsive, which compromised system functionality during cold environment tests. While a certain cause has not been identified yet, the team suspected that the RC circuit-based clock led to the initial crash during the first cold cycle and the MCU complete unresponsiveness emerged due to the underclocking of the microcontroller while using the wrong model of the temperature-compensated crystal, during the second cold cycle. However, a failure of the Central Processing Unit could also occur from the manufacturing process resulting in a faulty component. Due to the high risk of damaging the board with cold tests outside the TVAC environment, caused by potential condensation from humidity, no further troubleshooting was conducted.

Given these changes and after thorough testing, having verified the board's stable behavior at hot temperatures, the team decided to repeat the environmental testing to verify that the solutions were effective.

4.5 Second Campaign

4.5.1 Vibration Testing Results

The OBC/ADCS board encountered significant issues during the VIBE testing leading to a failure of the qualification process. The testing followed a standard sequence across all three axes (X, Y, and Z), and while initial results were in line with expectations, a major anomaly occurred during the random sequence. A large amplitude shift of 20% was noted, which was attributed to the natural settling of the assembly. However, subsequent tests showed amplitude shifts reaching 481%, indicating a serious issue with the integrity of the DUT.

Upon thorough inspection [54] after the Z-axis testing, it was discovered that two critical inductors, responsible for magnetometer measurements on the X and Z axes, had detached from the PCB [55]. This detachment compromised the data acquisition from the magnetometer, rendering the results invalid [56]. As a result, the functional tests post-VIBE were conducted with limited functionality.

4.5.2 Thermal Vacuum Testing Results

The TVAC testing of the DUT encountered a few critical issues, though some components, like the NAND Flash, the MRAM, and the CAN Bus of the system per-

formed successfully. During the test, random crashes of both the OBC and the ADCS MCUs occurred intermittently [57], with the crashes becoming more frequent during transitions from hot to cold cycles. After re-flashing the OBC's MCU, during the cold temperature dwell, the board stabilized, but the ADCS's MCU consistently crashed under low temperatures and during transitions. Through software debugging [54] potential scheduling conflicts and hardware malfunctions were identified as causes. These issues, including potential GSE reliability and temperature-induced malfunctions, led to the conclusion the TVAC testing of the OBC/ADCS board was unsuccessful.

A post-TVAC inspection revealed no visible damage or deformations to the OBC, ADCS, or the voltage regulator PCB supplying the EQM. No permanent damage was sustained, so additional functional tests were deemed unnecessary.

5. Current Status

At present, the status of the board indicates that all systems are operational in ambient conditions and the board exhibits no critical faults. Despite that, the aforementioned issues related to the MCUs' unexpected behavior under certain temperature ranges remain under investigation. Following the second environmental testing campaign, more extensive testing of the board was required to identify the issues. The reproduction of the unstable behavior was not accomplished during a following thermal cycle that was conducted on the same board, using the exact same ground support equipment that was utilized during the official environmental qualification campaigns. Regarding the specifications of this test, the temperature range of 50°C to -30°C, which was considered adequate for the temperature range that the issues were noticed initially, was achieved for a shorter duration than the thermal cycles during the two campaigns, with a lower temperature gradient and using a thermal chamber, without the effect of the vacuum conditions.

As of the latest testing phase, after a thorough inspection of the TVAC Umbilical cable, it was observed that when bending the cable in different ways the functionality of the board was affected, resulting in the unstable behavior of the board both in ambient and in testing conditions. Another significant issue that resulted in the crashes of the OBC MCU, was identified to be the driver of the MRAM, which needs to be further optimised to meet critical timing constraints and edge cases during temperature transitions.

Following the replacement of the umbilical cable to eliminate any signal degradation, along with necessary software adjustments, the OBC MCU demonstrates full operational capacity under all conditions tested within the

thermal chamber.

Attempts to reproduce the ADCS MCU crash under similar conditions, outside a TVAC, have so far been unsuccessful, leaving it as the sole unresolved issue.

6. Future Work

Further investigation is required to reproduce the issues and fully understand the root cause of the MCUs' unstable performance, under specific environmental conditions. After the identification of the causes, a 3rd Environmental Testing Campaign will be pursued with a new manufactured model that will comply with any possible required changes, induced by the successful resolution of the problem.

Upon completing the prerequisite Space qualification, conducted and radiated emission EMC testing will be carried out, avoiding any destructive tests. With the characterization of the components of the PCB already completed, the next step will be the implementation of a Test Plan.

On the firmware side, optimization and finalization of the on-board software, including memory management, ECSS services implementation, and subsystem-level FDIR are included in the required work for the OBC. The implementation of these is considered necessary to ensuring the data handling and timing requirements related to the simultaneous control of the various subsystems of the satellite, thus minimizing the risk of system conflicts or communication breakdowns. On the ADCS side, the pending work comprises the finalization of the actuators' drivers and the integration of the determination and control algorithms in the onboard software.

Following the subsystem-level testing and verification, the integration process will be initiated. At an early phase, using a flatsat configuration as described in AcubeSAT's Manufacturing Assembly Integration and Verification Plan (MAIVP) [16], the communication of the OBC with the rest of the subsystems of the satellite will be tested and established. More specifically, the OBC will interface with the COMMS board, the EPS, the ADCS (including the ADCS MCU, the Reaction Wheel, the Magnetorquers and the photodiodes), the Antenna Deployment Mechanism, the Payload and the Solar Panels. Once the integration is complete hardware-wise, the remaining system-level software is to be finalized and the implementation of the switching of the operational modes of the satellite, FDIR, in orbit patching and packet storage is going to be tested.

7. Conclusion

The journey of developing AcubeSAT's OBC/ADCS board has been one of continuous iterations and learning. Through extensive testing, the team has refined the design,

solved critical issues, and improved the board's overall reliability. Each step has revealed important lessons that guided design improvements and provided the foundation for future testing. Looking forward, the team aims to finalize the software and hardware integration, while addressing remaining thermal challenges through additional testing campaigns, thus developing a subsystem qualified to support the AcubeSAT space mission.

8. Acknowledgements

We would like to express our gratitude all the members of the SpaceDot Team for their invaluable help and contribution during the development and testing of the On Board Computer of the AcubeSAT nanosatellite. Specifically, we wish to thank Konstantinos Kanavouras, Athanasios Theocharis for their preliminary work on the OBC subsystem, as well as Antonios Keremidis, Christina Koutsou, Xhulio Luli, Dimitrios Koukourikos for their work on the design and testing of the OBC/ADCS board and everyone that contributed to the subsystem throughout the years. We thank the ESA Education Office and "Fly Your Satellite! 3" Program for the expertise and feedback during the development process and for giving us access to the CubeSat Support Facility at the ESEC-Galaxia, Belgium, and sponsoring our travel and accommodation in order to perform both environmental test campaigns. Our warm gratitude extends to the Aristotle University of Thessaloniki for providing us with the proper infrastructure (lab & cleanroom) and especially the Department of Electrical and Computer Engineering. We also thank Prisma Electronics SA for catering to all our assembly and harness needs. We wish to thank Athanasios Theocharis, Georgios Kikas, Aikaterini Papadopoulou, Stavros Spyridopoulos for providing technical and editorial review. Lastly, we thank our families and friends that supported us all the way by showing patience and understanding.

References

- [1] AcubeSAT Team. *Mission Description & Operations Plan*. Version 2.1. May 2021.
- [2] M Langer et al. 'Reliability of CubeSats – Statistical Data, Developers' Beliefs and the Way Forward'. English. In: *Proceedings of the 30th Annual AIAA/USU Conference on Small Satellites*. 30th Annual AIAA/USU Conference on Small Satellites, SSC16 ; Conference date: 06-08-2016 Through 11-08-2016. 2016.
- [3] AcubeSAT Team. *System Design Definition & Justification File*. June 2021.
- [4] Microchip. *SAMV71Q21RT*.
- [5] LibreCube. *LibreCube Specification*.
- [6] AcubeSAT Team. *OBDH Design Definition & Justification File*. Feb. 2021.
- [7] AcubeSAT Team. *Failure Modes Effect Analysis Report*. Version 1.3. Feb. 2021.
- [8] AcubeSAT Team. *AOCS Design Definition & Justification File*. May 2021.
- [9] AcubeSAT Team. *OBSW Design Definition & Justification File*. Jan. 2021.
- [10] ISO CPP. *C++ Core Guidelines*.
- [11] John Wellbelove. *Embedded Template Library*.
- [12] FreeRTOS. *FreeRTOS Documentation*.
- [13] FreeRTOS. *FreeRTOS Supported Devices*.
- [14] AcubeSAT Team. *OBC Software Repository*.
- [15] AcubeSAT Team. *ADCS Software Repository*.
- [16] AcubeSAT Team. *Manufacturing, Assembly, Integration and Verification Plan*. Version 2.0. May 2021.
- [17] Microchip. *ATSAMV71Q21B-AAB*.
- [18] EVERSPIN. *MR4A08BUYS45*.
- [19] R. R. Katti et al. 'Heavy Ion Bit Response and Analysis of 256 Megabit Non-Volatile Spin-Torque-Transfer Magnetoresistive Random Access Memory (STT-MRAM)'. In: *2018 IEEE Radiation Effects Data Workshop (REDW)*. 2018, pp. 1–4. DOI: 10.1109/NSREC.2018.8584321.
- [20] Micron. *NAND Flash Memory MT29F32G08ABAAA*.
- [21] European Cooperation for Space Standardization. *Telemetry and telecommand packet utilization*. 16th Apr. 2016.
- [22] Libre Space Foundation. *SatNOGS COMMS*.
- [23] Texas Instruments. *CAN Transceiver TCAN33x*.
- [24] Microchip. *Microchip MCP9808 Temperature Sensor*.
- [25] Analog Devices. *Overvoltage-Undervoltage Protection Circuit*.
- [26] ISIS. *iMTQ*.
- [27] ClydeSpace. *RW210*.
- [28] Analog Devices. *Gyroscopes ADXRS453BEYZ*.
- [29] PNI. *3 Axis Magnetometer*.
- [30] KiCad Development Team. *KiCad*.
- [31] AcubeSAT Team. *OBC/ADCS Board PCB Files*.
- [32] European Cooperation for Space Standardization. *Manual soldering of high-reliability electrical connections*. 6th Mar. 2009.
- [33] European Cooperation for Space Standardization. *Methods for the calculation of radiation received and its effects, and a policy for design margins*. 15th Nov. 2008.
- [34] HEICO Group. *Tests & Radiations (TRAD) - FASTRAD*.
- [35] ESA. *MATERIALS & ELECTRICAL COMPONENTS LABORATORY*.
- [36] Texas Instruments. *TLC555*.
- [37] Texas Instruments. *SNx4HC595*.
- [38] Texas Instruments. *TLV225x*.
- [39] Texas Instruments. *CDx4HC02*.
- [40] Texas Instruments. *CD4043*.
- [41] ESA CubeSat Support Facility. *ESA CubeSat Support Facility*.
- [42] AcubeSAT Team. *AcubeSAT OBC Thermal-Vacuum Test Specification & Test Procedures v1.0*. Jan. 2023.
- [43] AcubeSAT Team. *AcubeSAT OBC Vibration Test Specification & Test Procedures v1.0*. Jan. 2023.
- [44] AcubeSAT Team. *AcubeSAT OBC Thermal-Vacuum Test Specification & Test Procedures v2.0*. Feb. 2024.

- [45] AcubeSAT Team. *AcubeSAT OBC Vibration Test Specification & Test Procedures v2.0*. Feb. 2024.
- [46] AcubeSAT Team. *Technical Specification - Verification Control Document*. July 2020.
- [47] ESA Education Office. *Fly Your Satellite Design Specification - Verification Control Document*.
- [48] AcubeSAT Team. *OBC Environmental Campaign Test Report 1*. May 2023.
- [49] AcubeSAT Team. *OBC/ADCS Board Temperature Sensors Underflow*. Version 5.0. June 2024.
- [50] AcubeSAT Team. *OBC/ADCS - CAN Bus Faulty Communication at Hot Temperatures*. Version 4.0. Apr. 2024.
- [51] AcubeSAT Team. *OBC/ADCS - CAN Bus Faulty Communication at Hot Temperatures*. Version 8.0. Sept. 2024.
- [52] AcubeSAT Team. *ADCS MCU Crashing at Cold Temperatures*. Version 5.0. Sept. 2024.
- [53] ECS. *ECS-TXO-2520-33-120-AN-TR*.
- [54] AcubeSAT Team. *OBC Environmental Campaign Test Report 2*. May 2024.
- [55] AcubeSAT Team. *Detached components after VIBE testing*. Version 5.0. Sept. 2024.
- [56] AcubeSAT Team. *Magnetometer separate axes measurements redundancy*. Version 4.0. Sept. 2024.
- [57] AcubeSAT Team. *OBC and ADCS MCUs rebooting/crashing during TVAC testing*. Version 1.0. June 2024.